

Aqua TROLL 600 Maintenance Kit

Part Number 0078940

Contents

- Replacement battery compartment hex screw driver
- Battery compartment desiccant
- Wiper screws (3)
- Wiper brush (3)
- Wiper brush holders (3)
- RDO calibration sponge (3)
- O-rings (18)
- Silicone O-ring lubricant
- Lens cloth
- Rubber bumpers (2)


Replace the desiccant when the desiccant has turned pink. The desiccant is included in the Aqua TROLL 600 Maintenance Kit (0078940).

Replace the Desiccant

1. Remove the battery cover.
2. Remove the backup wrench tool from the back of the battery compartment.
3. Insert the backup wrench into the small hole on the back side of the battery compartment and push the desiccant capsule out.
4. Insert a new desiccant capsule and push the capsule in fully using the wrench.

O-ring Replacement

Remove all old O-rings. Apply a very thin layer of silicone-based lubricant on the new O-rings prior to installation.

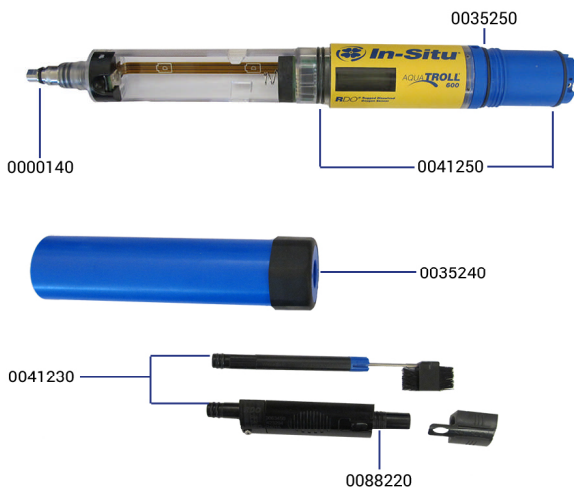

O-rings in the bag labeled 0041230 are used for all sensors, port plugs, and the wiper.

Desiccant

The Aqua TROLL 600 contains a small, replaceable desiccant capsule in the battery compartment. This capsule prevents moisture from causing damage to the electronic components. It is filled with color-indicating silica that gradually changes from purple to pink as the desiccant's effectiveness decreases.